AD NUMBER

ADB280825

NEW LIMITATION CHANGE

TO

Approved for public release, distribution unlimited

FROM

Distribution: Further dissemination only as directed by OSRD, Washington, DC 20330, Sep 1943; or higher DoD authority.

AUTHORITY

OSRD, per DTIC Form 55, dtd 14 Nov 2002.

A.P.O.(c)334.9/295

28 Sep 43

NATIONAL DEFENSE RESEARCH COMMITTEE

ARMOR AND ORDNANCE REPORT NO. A-218 (OSRD NO. 1868)

DIVISION 2

Unclassified

OSRD List 14

THIRD PROGRESS REPORT

ON

PLASTIC DEFORMATION OF STEEL UNDER HIGH PRESSURE

Sep 43

by

P. W. Bridgman

NATIONAL DEFENSE RESEARCH COMMITTEE

ARMOR AND ORDNANCE REPORT NO. A-218 (OSRD NO. 1868)

DIVISION 2

THIRD PROGRESS REPORT

ON

PLASTIC DEFORMATION OF STEEL UNDER HIGH PRESSURE

by

P. W. Bridgman

Approved on September 23, 1943
   for submission to the Division Chief

P. W. Bridgman
P. W. Bridgman, Consultant
Division 2

Merit P. White
Merit P. White, Secretary
Division 2

Approved on September 28, 1943
   for submission to the Committee

John E. Burchard
John E. Burchard, Chief
Division 2
Structural Defense and Offense

Preface

The work described in this report is pertinent to the project designated by the Navy Department Liaison Officer as HO-11 and to Division 2 project P2-302.

This work was carried out and reported by Harvard University as part of its performance under Contract OEMsr-201.

Initial distribution of copies of the report

Nos. 1 to 25, inclusive, to the Office of the Secretary of the Committee for distribution in the usual manner;

No. 26 to R. C. Tolman, Vice Chairman, NDRC;

No. 27 to R. Adams, Member, NDRC

No. 28 to F. B. Jewett, Member, NDRC;

No. 29 to J. E. Burchard, Chief, Division 2;

No. 30 to W. Bleakney, Deputy Chief, Division 2;

No. 31 to W. F. Davidson, Office of the Chairman, NDRC;

No. 32 to R. A. Beth, Member, Division 2;

No. 33 to H. L. Bowman, Member, Division 2;

No. 34 to C. W. Curtis, Member, Division 2;

No. 35 to C. W. Lampson, Member, Division 2;

No. 36 to W. E. Lawson, Member, Division 2;

No. 37 to H. P. Robertson, Mission London;

No. 38 to F. Seitz, Member, Division 2;

No. 39 to A. H. Taub, Member, Division 2;

No. 40 to E. B. Wilson, Jr. Member, Division 2;

Nos. 41 and 42 to R. J. Slutz, Technical Aide, Division 2;

No. 43 to Army Air Forces (Brig. Gen. B. W. Chidlaw);

Nos. 44 and 45 to Corps of Engineers (Col. J. H. Stratton, Lt. Col. F. S. Besson, Jr.);

No. 46 to Ordnance Department (Col. S. B. Ritchie);

No. 47 to M. P. White, Technical Aide, Division 2;

No. 48 to Corps of Engineers (Lt. Col. S. B. Smith);

No. 49 to Watertown Arsenal (Col. H. H. Zornig);

No. 50 to Aberdeen Proving Ground (O. Veblen);

Nos. 51 and 52 to Bureau of Ordnance (Lt. Comdr. T. J. Flynn, A. Wertheimer);

No. 53 to U. S. Naval Proving Ground (Lt. Comdr. R. A. Sawyer);

No. 54 to David Taylor Model Basin (Capt. W. P. Roop);

No. 55 to Bureau of Ships (Lt. Comdr. R. W. Goranson);

No. 56 to Bureau of Yards and Docks (War Plans Officer);

No. 57 to U.S. Naval Research Laboratory (R. Gunn);

No. 58 to D. S. Clark, Consultant, Division 2;

No. 59 to A. Nadai, Consultant, Division 2;

No. 60 to P. W. Bridgman, Consultant, Division 2.

CONTENTS

List of Figures

vi

THIRD PROGRESS REPORT ON

PLASTIC DEFORMATION OF STEEL UNDER HIGH PRESSURE

Abstract

Tests of the mechanical properties of steels under
high hydrostatic pressure which were described in
previous reports[1,2] were continued, using four samples
of armor plate of varying ballistic qualities. The
conclusion, in accord with the results of other lines
of investigation, is that ballistic behavior is closely
associated with fairly obvious characteristics -- such
as inhomogeneity, brittleness, and so forth -- which
can be investigated by standard methods. The conclu-
sions regarding strain hardening and conditions for
fracture, given in the earlier reports, have been
improved, but not essentially changed, by considering
the true stress state in the neck of a tensile specimen.

1. Introduction

The present work constitutes an attempt to answer one of the
original questions that was deemed important when this program was
initiated, namely, whether by taking account of the properties of
plate under pressure it might be possible to anticipate ballistic
failure. The question was of interest because at that time there
were many cases of obscure correlation between ballistic failure
and the more usual physical properties; but it could not be
answered in the two earlier reports[1,2] because samples of plate
which had failed to meet the ballistic tests were not then avail-
able.

In this report data are given for the effect of hydrostatic
pressure on the tensile properties of four samples of armor plate.

_____

1/ P. W. Bridgman, Plastic deformation of steel under high
pressure, NDRC Report A-95 (OSRD No. 919).

2/ P. W. Bridgman, Second progress report on plastic deforma-
tion of steel under high pressure, NDRC Report A-162 (OSRD No. 1347).

Table I. Physical properties of the three new plates as reported by Doctor M. Gensamer of the Carnegie Institute of Technology.

Plate No.	Thickness (in.)	Ballistic Performance	Type Specimen*	Average Tensile Data			Average V-notch Charpy Impact Test**	
				Tensile Strength (10³ lb/in²)	Elongation (percent)	Reduction in Area (percent)	Temperature of Test (°C)	Energy (ft lb)
18A	1.5	Passed; 100 ft/sec above specification	Length	137	19	59	0	36
			Width	138	17	50	-40	25
			Thickness	135	12	31	-60	20
17F	1.5	Failed; back spall 2-3/16 × 3-7/8 in.	Length	131	20	61	0	34
			Width	130	14	41	-40	29
			Thickness	99	2	8	-60	21
13F	2	Failed; cracked through thickness of plate in a plane normal to the surface of the plate	Length	135	17	59	0	24
			Width	131	16	54	-40	15
			Thickness	126	10	21	-60	12

*Length specimens taken parallel to direction of rolling, width specimens perpendicular to direction of rolling, thickness specimens perpendicular to face of plate.

**Long axis of specimen taken perpendicular to direction of rolling, notch taken in thickness direction.

Partial data have already been presented for one of these plates[3] but three of the plates are new. The particular significance of these three new plates is that other of their physical properties have already been examined elsewhere. Two of these plates had failed in the ballistic test.

The three new plates were supplied by Dr. M. Gensamer, of the Carnegie Institute of Technology, who provided a description of their physical properties[4] These are presented in Table I.

The measurements of the present report differ from those of the two earlier reports in that the effect of orientation in the plates was more carefully examined, tests being made on specimens cut in three mutually perpendicular directions: parallel to face and parallel to rolling (X-direction); parallel to face and perpendicular to rolling (Y-direction); and perpendicular to face (Z-direction). The fourth plate, designated 6X1 in the first report, was examined with respect to the strain-hardening curve and the effect of pressure on the character of the fracture, points that had received only inadequate consideration in the first report. The particular plate 6X1 was selected because previous experience had shown that it was of good homogeneity.

2. Distribution of stress across the necked specimen

The results presented here have been improved in one important respect in comparison with those of the two previous reports. It is known that the tension is not uniformly distributed across the neck of a tension specimen, and that this lack of uniformity will affect the value of the flow and rupture stresses calculated from tension experiments. Previously, there has been no satisfactory method of calculating the precise distribution of stress across the necked specimen, and in the absence of such precise knowledge it has been the custom to report the results in terms

---

3/ Reference 1.

4/ In two personal letters dated Dec. 23, 1942 and Aug. 3, 1943.
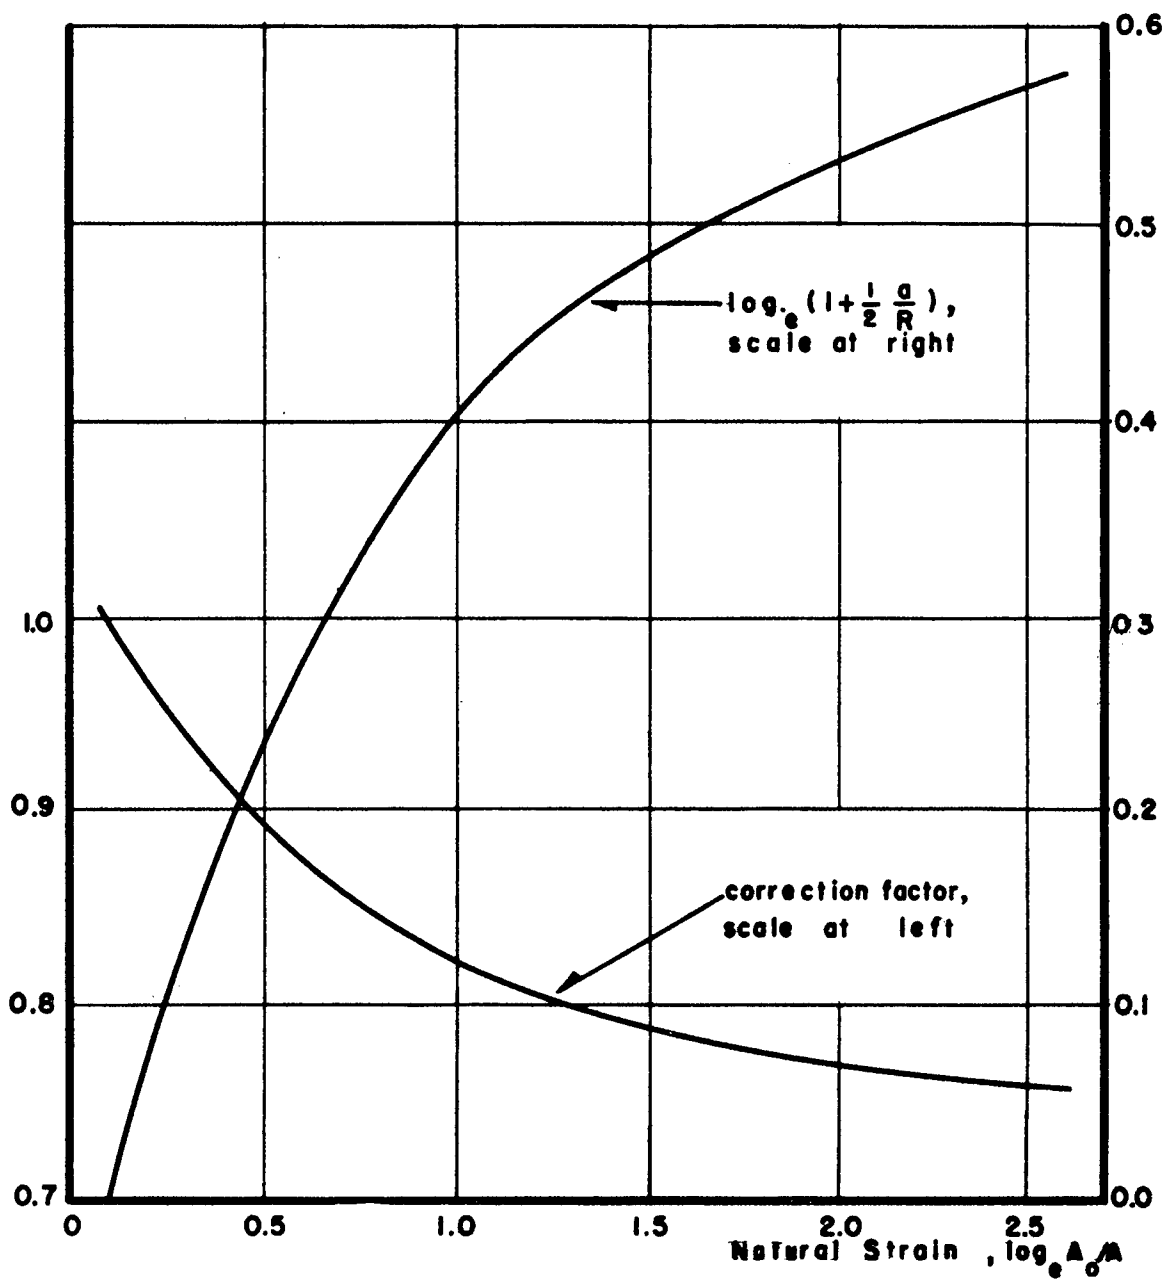
Fig.1. TWO CURVES RELATING TO THE EFFECTS OF NECKING IN TENSION SPECIMENS.

of the average tension across the neck. Under ordinary circum-
stances it was to be anticipated that the correction for lack of
uniformity was not very serious; but with the abnormally large
degree of necking which prevails in these experiments because of
the great increase of ductility under hydrostatic pressure, the
correction may be expected to become more important. Fortunately,
since the publication of the first two reports, a method has been
found for obtaining the precise distribution of stress across the
neck and for evaluating the correction arising from lack of
uniformity.[5/] The results given in the present report are corrected
for this effect; in order to permit comparison with previous work,
the uncorrected results are also given. In some cases, where the
necking is extreme, the corrected stress of flow may be 75 per-
cent of the uncorrected stress. So much of the results of the
analysis as is necessary for present purposes is reproduced in the
two curves of Fig. 1. One curve shows the correction factor in
terms of the "natural" strain at the neck, that is, $\log_e A_0/A$,
where A_0 is the initial cross-sectional area and $\underline{A}$ is the final
cross-sectional area; the other curve shows the factor by which
may be calculated the hydrostatic tension on the axis generated
by the necking. The detailed analysis evaluates these two factors
in terms of the ratio of the radius of curvature of the contour at
the neck to the radius of the neck, and not in terms of the natural
strain at the neck. However, it is an empirical result, valid
over a wide range of conditions, that to the degree of approxima-
tion of the present experiments the ratio of the two radii may be
taken to be a universal function of the natural strain. By means
of the curves of Fig. 1, the stresses given in the two first
reports may be corrected. The effect of the correction is to
diminish the tabulated flow and fracture stresses; the fraction
by which these stresses are to be diminished is greater, the
greater the reduction of area.

5/ The detailed analysis is in course of publication by the
American Society for Metals.

3. Relation between flow stress and natural strain

Application of the correction for necking does not alter the important result of the second report, that is, the true flow stress is a linear function of the natural strain. However, recognition of the existence of the correction alters the qualitative nature of the picture with regard to fracture. To show what the character of this change is it will be necessary to describe in further detail the results of the analysis.

Consider a tension specimen pulled under normal conditions in a testing machine at atmospheric pressure to such an amount that there is appreciable necking. At the neck there is a distribution of stress which may be analyzed into the sum of two distributions. The first is a tensile stress along the axis of the specimen and constant across the section of the neck; the second is a hydrostatic tension which vanishes at the outer surface of the neck and which increases to a maximum value on the axis according to a law that is given explicitly in the afore-mentioned paper. On the axis the hydrostatic tension is the product of $\log_e(1 + \frac{1}{2}\frac{a}{R})$ and the constant tension, where a is the radius of the neck and R is the radius of curvature of the contour at the neck. If we represent the stresses in conventional cylindrical coordinates -- z along the axis, r along the radius and θ in the plane through the radius at right angles to the z-axis -- then the principal stresses are as follows:

At the outside surface	On the axis
$\widehat{rr} = 0$	$\widehat{rr} = F \log_e(1 + \frac{1}{2}\frac{a}{R})$
$\widehat{\theta\theta} = 0$	$\widehat{\theta\theta} = F \log_e(1 + \frac{1}{2}\frac{a}{R})$
$\widehat{zz} = F$	$\widehat{zz} = F \log_e(1 + \frac{1}{2}\frac{a}{R}) + F$

where F is determined by the condition that the integral of $\widehat{zz}$ across the section shall equal the applied tensile load.

In the region of plastic flow before rupture the specimen is flowing uniformly and the strain is constant across the narrowest

section of the neck. The rate of flow or the amount of strain hardening is assumed in the analysis to be independent of the hydrostatic component of the total stress, an assumption which is amply justified by experiment. Hence a strain hardening curve is to be constructed by plotting the simple tensile component $\underline{F}$ against the natural strain at the neck, and this is also the strain-hardening curve if the total stress system is the sum of $\underline{F}$ and a hydrostatic term. It is shown in the paper mentioned that $\underline{F}$ is obtained by dividing the conventional average tensile stress -- that is, the total tensile load divided by the cross-sectional area at the neck -- by $(1 + 2\frac{R}{a}) \log_e (1 + \frac{1}{2}\frac{a}{R})$. The reciprocal of this expression is the "correction factor" shown in Fig. 1.

Fracture, unlike plastic flow before fracture, does not occur uniformly across the neck but is initiated at a particular point on the axis, where the total stress system has a uniquely determined value. Now it is well established by experiment that fracture, unlike plastic flow, is strongly dependent on the hydrostatic component of the total stress system, the strain at fracture increasing greatly with superposed hydrostatic pressure. In order to characterize completely the conditions of fracture in a tensile test, three parameters should be given: the strain, the simple tensile component, $\underline{F}$, and the hydrostatic component, $F \log_e (1 + \frac{1}{2}\frac{a}{R})$. This complete specification could not be given before the correction for necking was known.

If the tensile test is made in a medium under hydrostatic pressure, then the complete stress system is the sum of three systems, the two just considered and the imposed hydrostatic pressure. This imposed hydrostatic pressure does not affect the flow parameters, and the strain hardening curve is still to be specified by giving $\underline{F}$ as a function of the strain at the neck. The hydrostatic component of the stress at fracture is now, however, the hydrostatic tension arising from the necking, which is equal to $F \log_e (1 + \frac{1}{2}\frac{a}{R})$, minus the imposed hydrostatic pressure.

We pass now to a consideration of the actual measurements. The detailed arrangements of the experiments of this third report, including the dimensions of the specimens, were exactly like those in the second report; 6/

4. Detailed results and discussion

The results are summarized in Tables II to V and Figs. 2 to 14. As in the previous report, each entry or point in a diagram is a condensation of an entire curve, consisting of 10 to 20 readings of tensile load, hydrostatic pressure and extension. It is not necessary to reproduce the original curves in detail; the significant parameters of these curves are the data given here.

Most of the entries in the tables are self-explanatory. The "Corrected true stress at fracture" of column 9 is the same as the $\underline{F}$ of Sec. 3. The "Hydrostatic tension on axis arising from necking" of column 10 is $F \log_e (1 + \frac{1}{2} \frac{a}{R})$. The "Net hydrostatic tension on axis" of column 11 is column 10 minus the maximum corresponding pressure of column 2. The "Net tension at fracture" of column 12 is column 9 plus column 11. The values listed in the tables for atmospheric pressure agree fairly well with the values reported by Gensamer, obtained under different experimental conditions.

(a) <u>Relation between true stress at fracture and natural strain at the neck.</u> -- These new results in the first place substantiate results previously found. Consider, for example, Figs. 2, 5, 8 and 11. In these the true stress at fracture, corrected for the nonuniformity of the stress distribution at the neck, appears to be a linear function of the natural strain at the neck at fracture. In the previous report the uncorrected true stress was also found to be such a linear function. All the test pieces of the present report were pulled to fracture; in previous work the tests were often not carried to fracture, and it was found that the stress-strain relation below fracture follows the same linear relation as that which represents the fractures. In other words, the corrected true stress at the neck, plotted against

---

6/ Reference 2.

the running natural strain at the neck, moves along the straight lines of the figures as strain increases during the course of an experiment. Fracture is a catastrophe that suddenly terminates the experiment without the running point leaving the line or without any other warning. This means that the lines of Figs. 2, 5, 8 and 11 are essentially concerned with the phenomena of plastic flow and strain-hardening and not with fracture. This is emphasized further by reference to the effect of orientation.

(b) Dependence of strain-hardening and fracture phenomena on orientation. — In Figs. 2, 5 and 8, the points for the three orientations all lie on the same lines independent of the orientation, which means that for a given natural strain the true stress and therefore the strain-hardening is independent of orientation. However, specimens with different orientations vary in their fracture phenomena. For example, the X-direction of plate 13F breaks under atmospheric pressure at a corrected true stress of 15,300 kg/cm², whereas the corresponding fracture stress for the Z-direction is only 10,600 kg/cm². Although fracture in the Z-direction occurs before fracture in the X-direction, up to the instant of fracture the stress-strain curves for the two directions have been identical. The natural strain at fracture for the X-direction is 0.936, and that for the Z-direction much less, only 0.275.

(c) Numerical parameters of the strain-hardening curves. — The numerical parameters of the strain-hardening curves of the four different plates differ only slightly. We may take for these parameters (i) the value of the flow stress at a natural strain of 0.1, which is approximately the point where necking begins in a tension specimen, and (ii) the stress at a natural strain of 3.0. The latter parameter is probably the more significant of the two under the conditions of armor penetration because it indicates the resistance at high degrees of distortion. The stress at a natural strain of 0.1 for the plates 18A, 13F, 17F and 6X1 is, respectively, 12,500, 10,000, 10,400 and 7,000 kg/cm², and the

Table II. Summary of tension tests under pressure on plate 18A.

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9	Column 10	Column 11	Column 12	Column 13
Orientation of Specimen	Pressure Range of Tests (kg/cm²)	Ratio of Original Area to Final Area A_o/A	Reduction of Area (percent)	Natural Strain at Fracture $\log_e(A_o/A)$	Average Stress on Original Area at Maximum Load (kg/cm²)	Average Stress on Original Area at Fracture (kg/cm²)	True Stress at Fracture (kg/cm²) Uncorrected	Corrected	Hydrostatic Tension on Axis Arising from Necking (kg/cm²)	Net Hydrostatic Tension on Axis (kg/cm²)	Net Tension at Fracture (kg/cm²)	Ratio of Area of Tensile Fracture to Total Area of Neck
X	Atmos.	2.62	61.8	0.963	10240	8170	21400	17800	6800	6800	24600	0.530
	5500 7100	4.85	79.3	1.579	11160	5370	26000	20300	10400	3300	23600	.199
	8900 13200	8.84	88.7	2.179	12200	4310	30500	23100	12900	-300	22800	.019
Y	Atmos.	1.60	37.4	0.468	10600	10290	16400	14800	3100	3100	17900	—
	5350 6900	4.06	75.4	1.401	12000	5750	23400	18500	9100	2100	20600	0.149
	8750 13350	9.37	89.4	2.238	11460	3400	31900	24300	14100	700	25000	.086
Z	Atmos.	1.98	49.6	0.685	10820	9230	18300	15800	4700	4700	20500	0.545
	5100 6900	4.79	78.9	1.567	10720	5010	24000	18800	9600	2700	21500	.148
	8600 13100	7.01	85.7	1.947	11620	4050	28400	21800	12000	-1100	20700	.000

Table III. Summary of tension tests under pressure on plate 13F.

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9	Column 10	Column 11	Column 12	Column 13
Orientation of Specimen	Pressure Range of Tests (kg/cm²)	Ratio of Original Area to Final Area A_o/A	Reduction of Area (percent)	Natural Strain at Fracture $\log_e(A_o/A)$	Average Stress on Original Area at Maximum Load (kg/cm²)	Average Stress on Original Area at Fracture (kg/cm²)	True Stress at Fracture (kg/cm²) Uncorrected	Corrected	Hydrostatic Tension on Axis Arising from Necking (kg/cm²)	Net Hydrostatic Tension on Axis (kg/cm²)	Net Tension at Fracture (kg/cm²)	Ratio of Area of Tensile Fracture to Total Area of Neck
X	Atmos.	2.55	60.8	0.936	9800	7220	18400	15300	5800	5800	21100	0.277
	1500 2000	3.15	68.3	1.147	9860	6600	20800	16800	7400	5400	22200	.276
	2800 3400	3.69	72.7	1.306	11780	6310	23300	19700	9200	5800	25500	.198
	5100 6800	5.61	82.2	1.725	12080	4750	26700	20800	11000	4200	25000	.155
	8950 13700	19.1	94.8	2.949	10500	1720	32800	24500	15000	1300	25800	.000
Y	Atmos.	2.12	52.8	0.752	9680	7730	16400	14000	4500	4500	18500	0.382
	5550 7080	6.34	84.2	1.847	10450	4070	25800	19900	10700	3600	23500	.087
	8800 13400	15.54	93.6	2.743	10210	2120	33000	24700	14800	1400	26100	.007
Z	Atmos.	1.32	24.2	0.275	9100	9000	11200	10600	1300	1300	11900	
	5100 6850	4.13	75.7	1.418	10700	4850	20100	15900	7800	1000	16900	
	7600 8020	5.76	82.5	1.751	11120	4140	23800	18500	9800	1800	20300	
	8900 13600	21.0	95.3	3.015	10550	500-	(35000)	(26100)	16000	2400	(28500)	

Table IV. Summary of tension tests under pressure on plate 17F.

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9	Column 10	Column 11	Column 12	Column 13
Orientation of Specimen	Pressure Range of Tests (kg/cm²)	Ratio of Original Area to Final Area A_o/A	Reduction of Area (percent)	Natural Strain at Fracture $\log_e (A_o/A)$	Average Stress on Original Area at Maximum Load (kg/cm²)	Average Stress on Original Area at Fracture (kg/cm²)	True Stress at Fracture (kg/cm²) Uncorrected	True Stress at Fracture (kg/cm²) Corrected	Hydrostatic Tension on Axis arising from Necking (kg/cm²)	Net Hydrostatic Tension on Axis (kg/cm²)	Net Tension at Fracture (kg/cm²)	Ratio of Area of Tensile Fracture to Total Area of Neck
X	Atmos.	2.74	63.5	1.008	9820	7250	19900	16400	6500	6500	22900	0.468
	5450 7100	5.05	80.1	1.619	11000	4900	24900	19400	9900	2800	22200	.128
	8800 13700	13.15	92.5	2.576	11150	2560	33600	25400	15000	1300	26700	.000
Y	Atmos.	1.87	46.6	0.625	10260	9610	18000	15600	4400	4400	20000	—
	Atmos.	2.19	54.3	.786	12740	10960	24000	20500	6800	6800	27300	0.438
	5200 6200	2.02	50.6	.705	10750	8390	17000	14600	4500	-1700	12900	—
	8900 11600	2.27	56.0	.820	10600	?	?	?				—
Z	Atmos.	1.06	6.1	0.062	10000	10000 ?	?	?				—
	Atmos.	1.27	21.6	.243	9800	9500	12100 ?	11500 ?				—
	5250 5950			Too irregular for measurement								
	8600 10900			Too irregular for measurement								

Table V. Summary of tension tests under pressure on plate 6X1 (X-direction).

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9	Column 10	Column 11	Column 12	Column 13
X	Atmos.	2.93	66.0	1.075	9190	5760	16900	13800	5800	5800	19600	0.33
	1400 2000	3.57	71.9	1.272	9700	5410	19300	15400	7100	5100	20500	.27
	6200 8200	8.38	88.6	2.126	9840	3250	27200	20800	11600	3400	24200	.09
	8400 11100	11.94	91.7	2.490	10140	2100	25000	19000	11200	100	19100	.06
	8750 13900	19.85	95.2	2.988	10120	1740	34500	25800	15800	1900	27700	.03

- 12 -

corresponding stresses at a natural strain of 3.0 are 27,500, 25,800, 27,700 and 25,700 kg/cm². These latter figures are so similar that very similar ballistic behavior of the four plates is to be expected, other things being equal. Included in the "other things being equal" is homogeneity.

(d) _Increase of ductility with hydrostatic pressure._ -- We now turn from a consideration of the phenomena of plastic flow to the phenomena of fracture. In the second report it was shown that the ductility, as measured by the natural strain at fracture, increases linearly with hydrostatic pressure. In Figs. 3, 6, 9 and 12, the pressure at which the specimen was pulled is plotted against the natural strain at fracture. There is much scattering of the points, indicative of the lack of homogeneity of the material, but within the limits of error, the relation again seems to be linear. The first three plates -- 18A, 13F, and 17F -- are arranged in order of increasing inhomogeneity. That this is the proper order is shown by the way in which the points are scattered. For plate 18A the points representing the X-, Y- and Z-orientations all lie on the same line within the limits of error. For plate 13F the points of the X- and Y-orientations are roughly on the same line, whereas those of the Z-orientation tend to lie on another line corresponding to easier fracture in this direction. Finally, for 17F the points are much more irregular; only the points for the X-direction tend to lie on a line at all; the points for the Y-direction are badly scattered, and for the Z-direction the results are so capricious that measurements could be made at all only for two out of four specimens tested. It happened that these two measurable specimens were those tested under atmospheric pressure.

(e) _Principal stress components at fracture._ -- Columns 11 and 12 of Tables II to V determine the principal stress components at fracture. In fact, both $\hat{rr}$ and $\hat{\theta\theta}$ have the value given in column 11 and $\hat{zz}$ has the value given in column 12. The three components could be plotted together in three dimensions to give

a fracture surface. When the stress in the substance attains a
value corresponding to a point on the surface, fracture occurs.
The strain at fracture is another parameter, varying from point
to point of the surface. Special values of it are given in
column 4.

In general, the stress components $\widehat{rr}$ and $\widehat{\theta\theta}$ shown in column 11
diminish with increasing hydrostatic pressure (column 2) or with
increasing strain at fracture. One would expect a regular connec-
tion, but if column 11 is plotted against column 2 or 5, great
irregularity will be found. Fracture data are always capricious,
and the irregularity is enhanced here by the fact that column 11
is the small difference of nearly equal numbers. The greatest
regularity is shown by the most homogeneous steel, 6X1. The fourth
test on this plate is out of line with the others; this may be
plausibly explained by premature fracture due to a flaw. If this
point is discarded, the others are fairly regular. If now $\widehat{rr}$ (or
$\widehat{\theta\theta}$) for 6X1 is plotted against $\widehat{zz}$, a straight line is obtained.
This line may be extrapolated to the point where $\widehat{rr} = \widehat{zz}$; it occurs
at about 10,000 kg/cm². The significance of the point of inter-
section is that here the total stress system which produces rupture
reduces to a hydrostatic tension. This hydrostatic tension which
produces rupture has often been called the cohesive strength; for
plate 6X1 the cohesive strength thus appears to be about
10,000 kg/cm².

We may obtain approximately the same result by another line
of argument. The mean hydrostatic tension corresponding to any
stress system is $(\widehat{rr} + \widehat{\theta\theta} + \widehat{zz})/3$. The mean hydrostatic tensions
for the first, second, third and fifth tests on 6X1 are, respec-
tively, 10,400, 10,200, 10,300 and 10,500 kg/cm². These are
constant, within limits of error -- an interesting result in
itself, doubtless of significance. Now when fracture occurs under
pure hydrostatic tension with no other stress component, the
strain must vanish. Hence, if we plot the four tensions just
calculated against the corresponding strains and extrapolate to

zero strain, the corresponding hydrostatic tension will be the cohesive strength. But since the four tensions are constant and hence independent of strain, the extrapolated value when strain vanishes is the same constant value, or approximately 10,000 kg/cm², checking with the result just obtained by another method. This figure for the cohesive strength is lower than would be estimated from previous speculations in the literature. The lowering of the figure is a result of the correction for necking.

(f) Character of the fracture. -- Finally, we consider the character of the fracture itself. In the second report it was shown that the cup and cone fracture which normally occurs under atmospheric pressure tends to disappear at high pressures, the area of the tensile part of the fracture -- that is, the flat bottom of the cup as distinguished from the sides where the fracture is on shear planes -- occupying a progressively smaller fraction of the total area of the neck, and vanishing altogether at pressures between 15,000 and 20,000 kg/cm². The last columns of Tables II to V and Figs. 4, 7, 10 and 13 show the fraction of the total area occupied by the tensile break as a function of the hydrostatic pressure during pulling. The result already found is substantiated; the ratio of the areas drops off linearly with increasing pressure, vanishing in the neighborhood of 15,000 kg/cm², a pressure above which the fracture is entirely along shear planes.

The greatest effects of difference of orientation and lack of homogeneity appear when one studies the character of the fracture. The X-direction for all plates -- that is, the direction parallel to the face and parallel to the direction of rolling -- permitted satisfactory measurements. The Y- and Z-directions for 18A also permitted such measurements, showing approximate homogeneity, whereas the Z-direction of plate 13F and both Y- and Z-directions of plate 17F in general gave such indefinite fractures that they could not be analyzed into a tensile and a shearing part. Plate 17F in particular gave highly abnormal fractures. Mention may be made especially of the specimen of 17F in the Z-direction
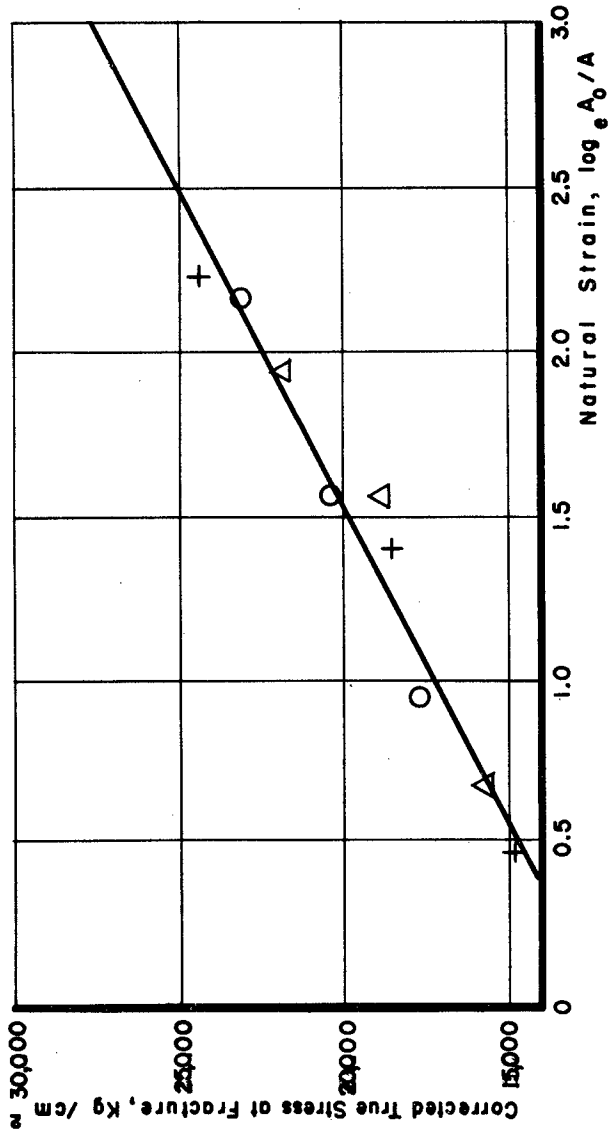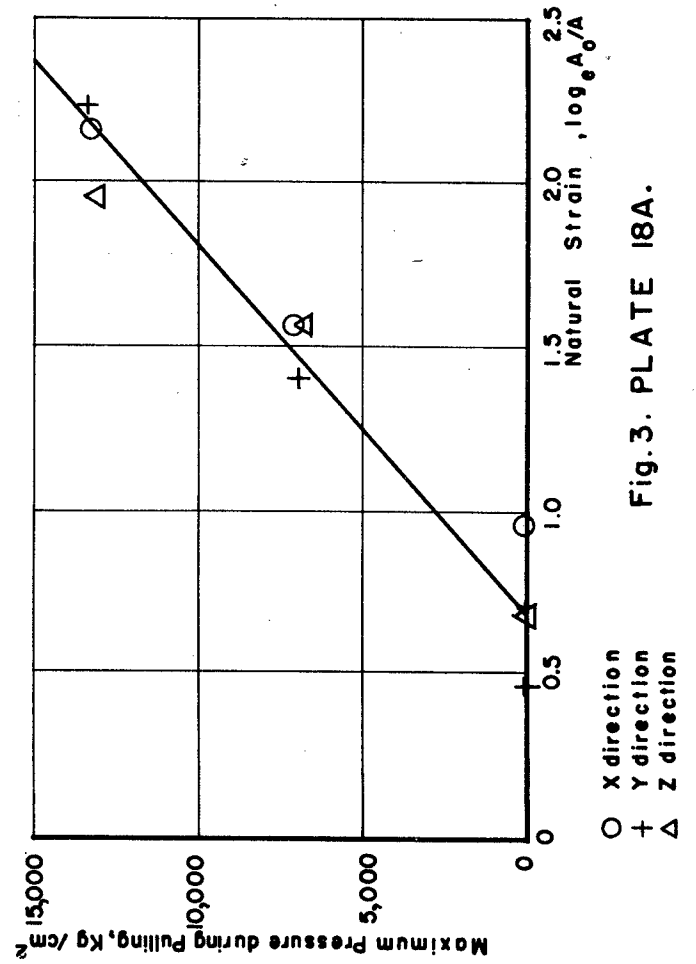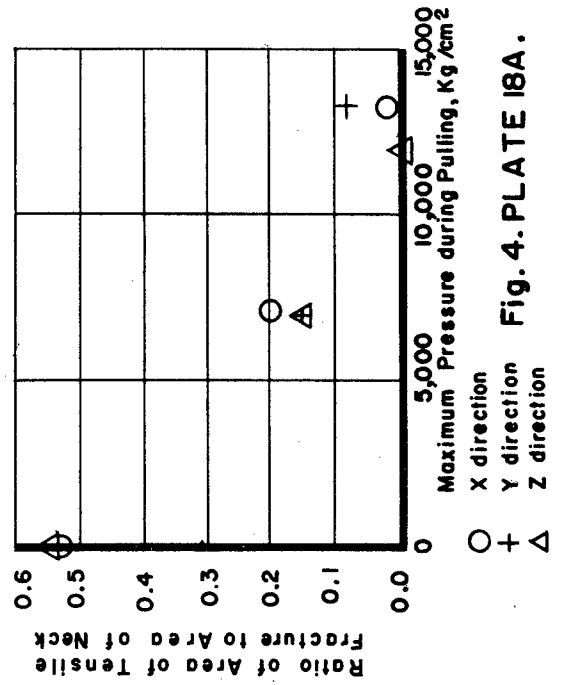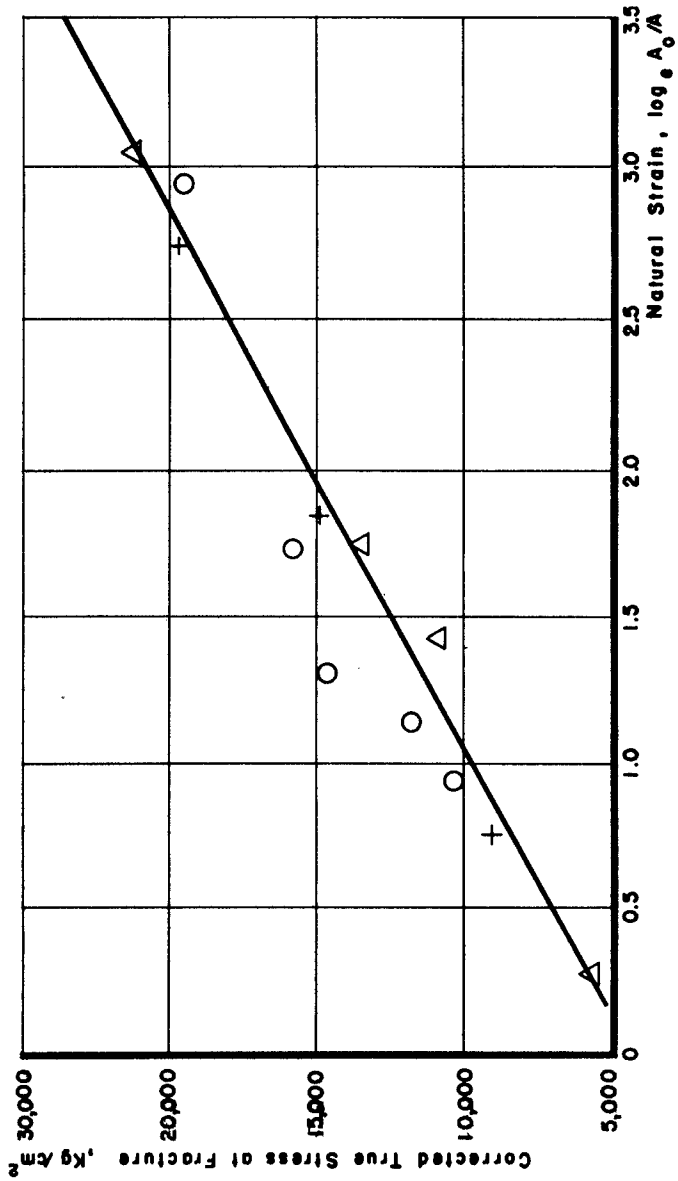
Fig.2. PLATE 18A.
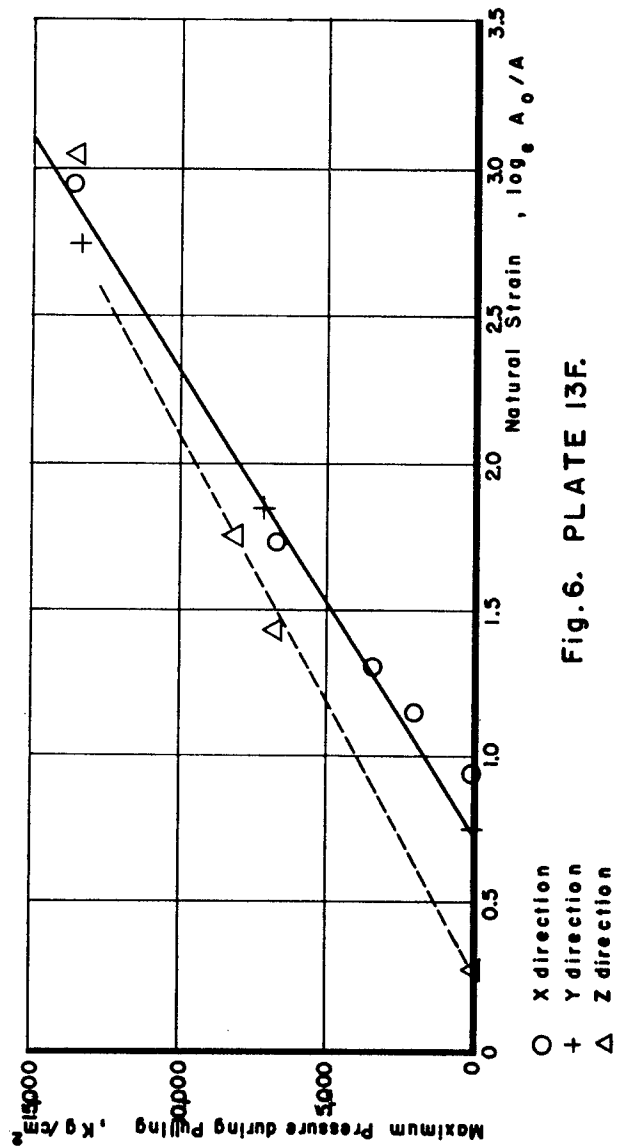
Fig.4. PLATE 18A.

Fig.3. PLATE 18A.

Fig.5. PLATE 13F.

O   X direction
+   Y direction
△   Z direction

Fig.6. PLATE 13F.

O   X direction
+   Y direction
△   Z direction

Fig. 7. PLATE 13F.

O X direction
+ Y direction
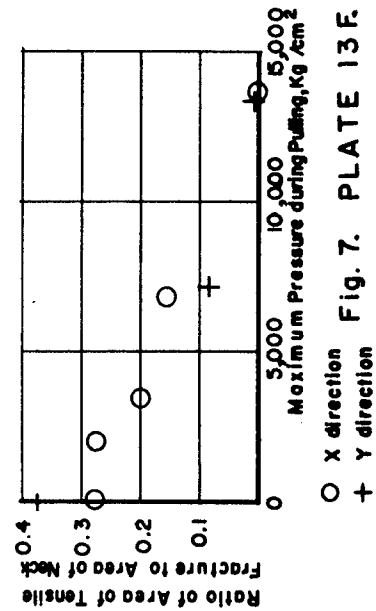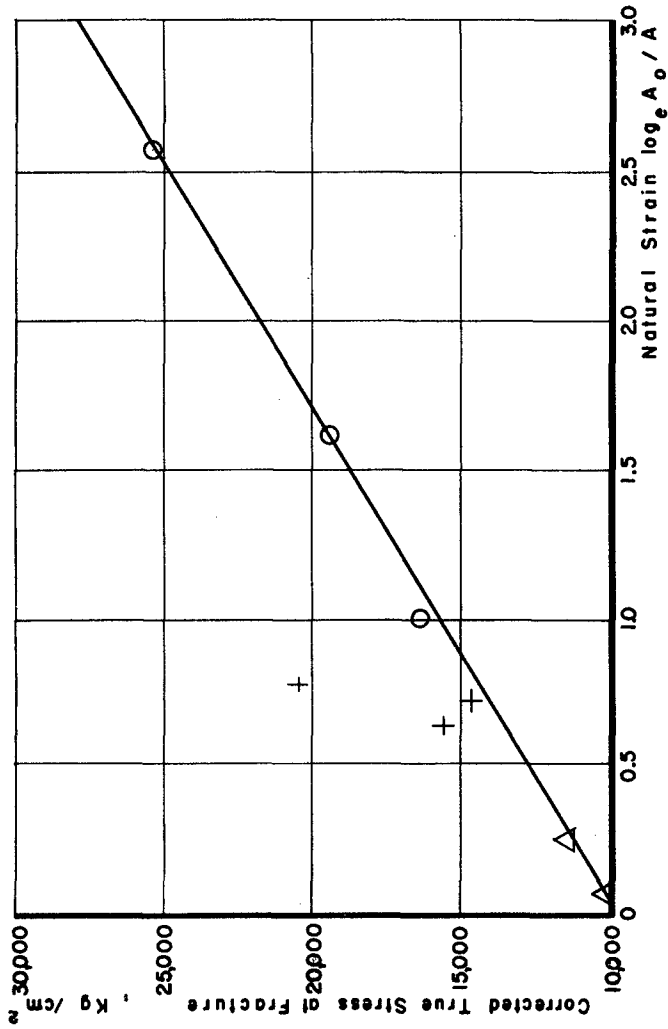
Fig.8. PLATE 17F.
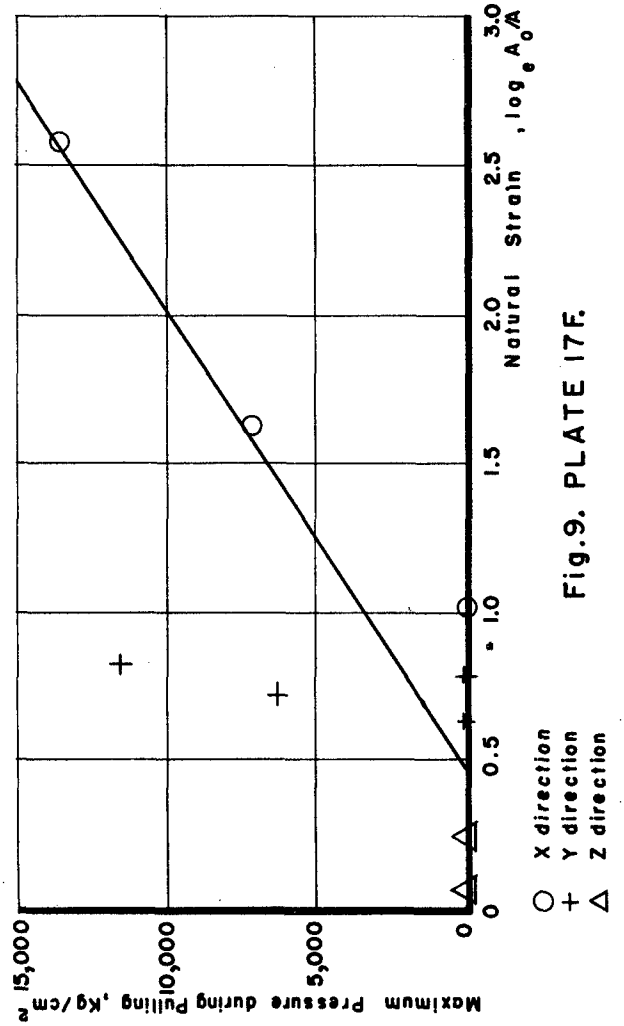
Fig.9. PLATE 17F.

Fig.10. PLATE 17F.

Fig. 8 (left chart):
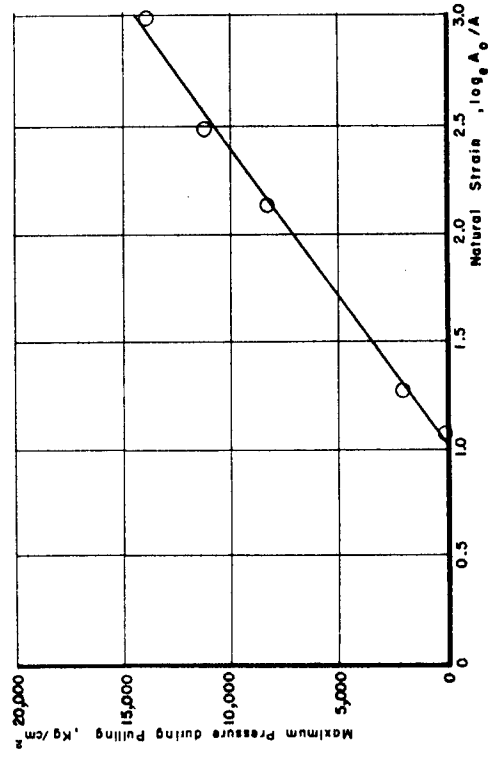
Corrected True Stress at Fracture , Kg /cm²

30,000
25,000
20,000
15,000
10,000

Natural Strain $\log_e A_0 / A$

0   0.5   1.0   1.5   2.0   2.5   3.0

○ X direction
+ Y direction
△ Z direction

Fig. 9 (middle chart):

Maximum Pressure during Pulling ,Kg/cm²

15,000
10,000
5,000
0

Natural Strain , $\log_e A_0 /A$

0   0.5   1.0   1.5   2.0   2.5   3.0

○ X direction
+ Y direction
△ Z direction

Fig. 10 (top right chart):

Ratio of Area of Tensile Fracture to Area of Neck

0.5   0.4   0.3   0.2   0.1   0

Maximum Pressure during Pulling, Kg /cm²

0   5,000   10,000   15,000

○ X direction
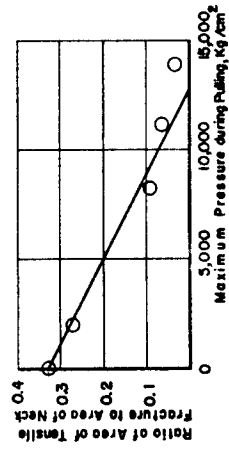+ Y direction

Fig. 11. PLATE 6XI.

Fig. 12. PLATE 6XI.

Fig. 13. PLATE 6XI.

which was pulled at a pressure of 11,000 kg/cm². In the course
of the experiment it was thought from the nature of the results
that the specimen had been pulled to fracture; but, on opening
the apparatus, separation was found to be incomplete, an axial
section through the neck having the appearance indicated in
Fig. 14 -- an open channel through the center with two isthmuses
on either side. This configuration
would appear to be the result of a
combination of high ductility in the
sound parts of the metal, imparted
by the pressure, and of strongly
segregated impurities, nonductile
and probably nonmetallic, such as
slag. The location of the inclu-
sions is such as to show up most
strongly for specimens with the
Z-orientation, but the effect of
their presence may be seen also in
the fractures of the X-orientation.
The shearing part of these fractures
never showed the clean-cut slip
planes characteristic of sound met-
al, but the surfaces of shearing
slip were dotted with minute pits,
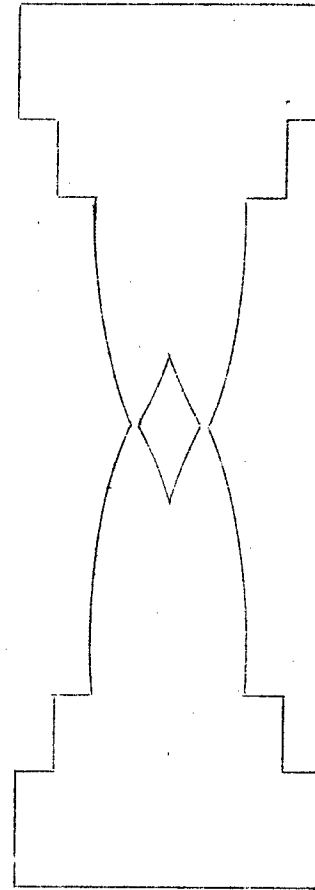giving a matt appearance.

Fig. 14. Double
neck on a tension speci-
men from plate 17F.

The pressure at which the
shearing fracture disappears is dis-
tinctly lower for the X-orientation
of plate 13F than for the other two.
In homogeneous plate this may be a significant feature, because
one might expect that the total energy to produce fracture would
be greater in a material in which the tensile -- that is, the
brittle -- fracture disappears at low compressive stress. This
would indicate that plate 13F should be better ballistically than

the other two. However, other disturbing effects arising from
lack of homogeneity would appear to be so great as to mask any
effects of this kind.

In studying the effect of pressure in changing the character
of the fracture a number of photographs have been made of longi-
tudinal sections through the tensile specimens of two of the
plates of the second report. The section was made by machining
away half the specimen. For convenience in machining and mounting
for photographing, the second shoulder of the specimen was first
machined off. Figure 15 shows one of the sectioned specimens
mounted for photographing. Figures 16, 17, 18 and 19 are enlarged
views of the neighborhood of the fracture for four specimens from
plate C14 which had been ruptured at pressures of 1 atm, 4,000,
10,000 and 15,000 kg/cm^2, respectively. These show in the first
place the progressively greater reduction of area as the pressure
at which the fracture occurs increases — that is, the increase of
ductility with increasing pressure. In the second place, the
change in the character of the fracture is clearly shown. The
"tensile" part of the fracture is the approximately plane surface
perpendicular to the axis; this progressively diminishes in extent,
both absolutely and relatively, with increasing pressure, until
at 15,800 kg/cm^2 it has entirely disappeared and the fracture is
all "shearing" in character, with a multiple cone of shear at the
center. It is especially to be noticed that the tensile part of
the break is situated at the smallest part of the neck, whereas
the shear runs into the outer surface where the neck is larger.

5. Conclusion

The final conclusion to be drawn from these measurements, as
far as ballistic applications are concerned, is one which, if it
had been anticipated, would probably have made unnecessary the
method of attack of this paper. The present measurements disclose
ample reason for the difference in ballistic behavior of the
different plates, but this difference does not depend on anything
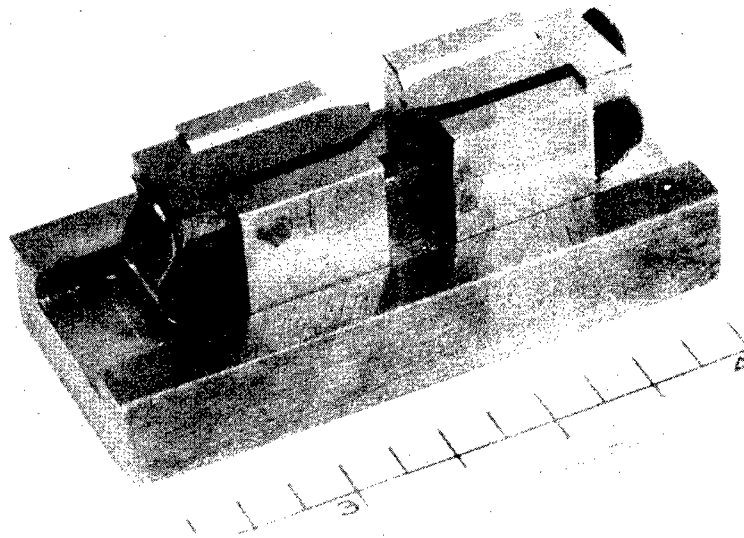
Fig. 15. Showing the method of sectioning a tension specimen. The scale is in inches.

Fig. 16. Specimen from plate C14 broken in tension under atmospheric pressure.

as subtle as a difference in the effects of hydrostatic pressure on the physical properties. Rather, it depends on lack of homogeneity due to large scale inclusions, the effect of which can be adequately shown by tensile tests under ordinary conditions at atmospheric pressure on specimens cut in different orientations. In other words, the bad plates are simply to be described as made from "dirty" steels. This seems to be the conclusion that is also being arrived at from other lines of evidence. It does not follow of necessity that all dirty steels will give plates of bad ballistic properties; but, on the other hand, if a plate is bad ballistically it is pretty likely to be made of a dirty steel, in the absence of such obvious characteristics as too brittle a temper, and so forth.

These present experiments show that the effect of pressure in increasing ductility carries over to dirty steels. The effect is differential; the ductility of the sound part of the metal is increased more than that of the inclusions so that the apparent inhomogeneity may be increased by hydrostatic pressure. A natural expectation would be that fractures in plates made of dirty steels would be initiated at points closer to the projectile than in plates of sounder steels.